


DENSO CoGeneration | GE3-5 Iridium Saver Spark Plug

DENSO have been made aware of an imitation GE3-5 Iridium Saver Spark Plug. If you experience poor lifetime or experience spark plug issues, please check that you have a genuine DENSO component. Please look out for the following differences which will have a dramatic effect on the lifetime, and possibly may have severe affects on the engine durability.

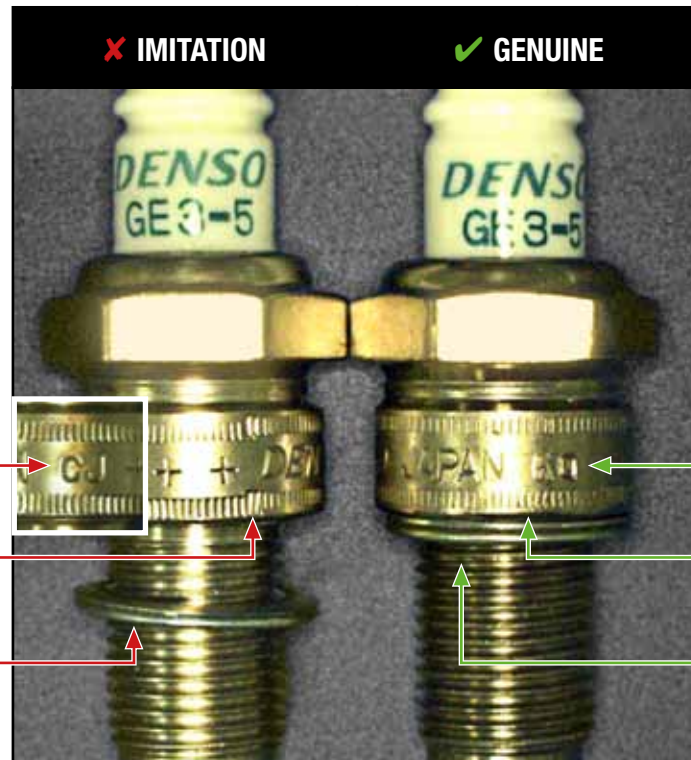

	MONTH	YEAR
B	January	J 2007
C	February	K 2008
D	March	L 2009
E	April	M 2010
F	May	N 2011
G	June	P 2012
H	July	Q 2013
J	August	R 2014
K	September	S 2015
L	October	T 2016
M	November	U 2017
N	December	B 2018

✗ Un-realistic date stamp code:
CJ > Februari 2007


✓ Realistic date stamp code:
KQ > September 2013

✗ Poor stamping on housing

✓ Good stamping on housing

✗ Sealing washer tight on thread
(On the fake plug the sealing washer can move freely up and down the thread)

✓ Sealing washer tight on thread
(On DENSO plug the sealing washer can not move up and down the thread)

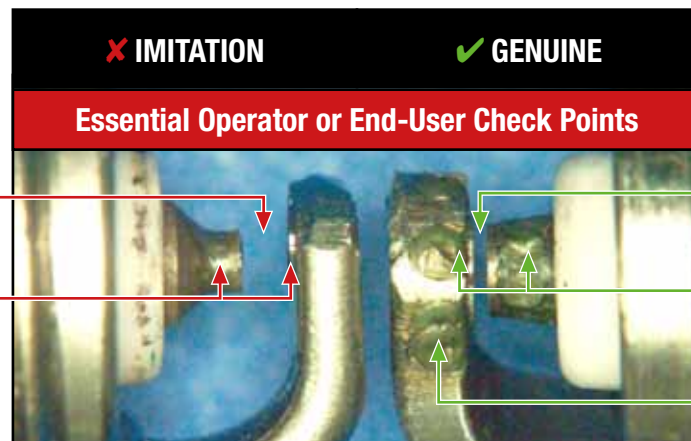

✗ Too large electrode air gap:
0,9mm

✓ Correct electrode air gap:
0,3mm

✗ Small electrode sizes:
1,3mm / 2,0mm

✓ Correct electrode sizes:
2,0mm / 2,4mm

Correct weld technique